

Pre Purchase Inspection

Comprehensive Book

Friday, April 26, 2024

Car Details

Car Brand: FORD

Model: EXPLORER

Year: 2016

Odometer reading: 156363KM

Engine Size: 3.6L

Car Details

Transmission: Automatic

Interior: Lather

Number of Keys: 1

VIN Number: 1FM5K8GT8GGC79550

Spare Tyres:

Technician Name

Gurpreet

Location

Ras Al Khor, Dubai

DISCLAIMER

Please read the entire report and note any faults identified.

Any major faults that could affect your safety should be attended to immediately.

This inspection is a visual report and no parts are dismantled or removed.

No responsibility will be taken for failure to identify faults not present or apparent at the time of the inspection.

This inspection in no way constitutes a guarantee against any future faults that may develop.

Should any complaints arise following this inspection then we reserve the right to re-inspect the vehicle prior to any rectifications to the vehicle.

No guarantee is given to the accuracy of the odometer, but any signs of tampering or inaccuracy will be commented on.

The vehicle air bags are passive restraints triggered by the impact sensors; their function cannot be tested.

Testing the car body for water leaks requires special facilities and testing equipment, however any signs of water stains and/or damp will be commented on.

No emissions testing will be conducted due to the need for dedicated equipment.

If the vehicle has no documentation that shows the cam belt has been changed at the recommended intervals, then we advise a replacement belt is fitted immediately.

If the vehicle air conditioning refrigerant is low or empty, then we cannot guarantee the air conditioning system is working without faults.

If the vehicle is fitted with a turbocharger or supercharger and has no gauges to show induction boost, then we are unable to guarantee the system is working to the correct specification. However, the inspector will comment on the performance following a road test if appropriate.


If an OBD computer scan is conducted then all system faults will be listed. The inspector will not reset the system or clear any historical faults.

If the vehicle has been run shortly before the inspection, then the inspector will be unable to perform a cold start and identify any potential starting issues.

An engine cylinder compression test is not possible due to the need for special testing equipment and the time needed to undertake such a test. The inspector will comment if a power imbalance exists due to unequal cylinder performance.

Automatic and manual four wheel drive systems are tested as far as possible given the area where the inspection is conducted. Traction and differential lock functions cannot be tested fully due to lack of suitable conditions.

BODY INSPECTION

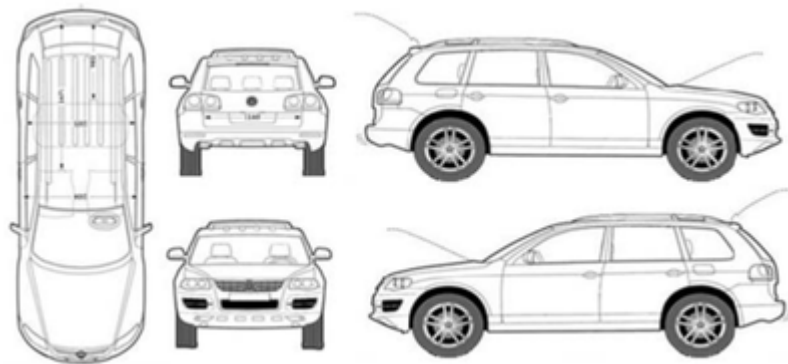

Front Right Door



Rear Right Door



Right Rocker Still Panel



Right Fender



Rear Windshield



Rear Windshield

PASS

Sub Frame

PASS

Fuel Filler cap

PASS

Mud Flaps

PASS

Fault Photo



Fault Photo



ENGINE & TRANSMISSION

Fault Photo



Fault Photo



Fault Photo



Fault Photo



Fault Photo



Transmission

Transmission Details

Fluid Level & Condition: Ok

Transmission Fluid Leaks: No have

Gear Selector: Automatic

Gear Shifting: Ok

Noise: No

Upload Fault Photos



Electrical System Details

Key Remote: 1

Entertainment System: Normal

Center Console Button: Ok

Door Lock/ Unlock: Ok

Cameras: Ok

Soft Closing Doors: No

Window Operations: Electronic

Wipers: Ok

Sunroof / Moonroof: Ok

Indicator and Hazard Lights: Ok

AC Grills: Good

Cruise Control: Ok

AC Control & Cooling: Good (3.5C)

Starting & Ignition: Ok

Gauges: Ok

Headlights/Fog lights: Ok

High Beams: Ok

Reverse Lights: Ok

Number Plate Lights: 1 light is not working

Interior Lights: Ok

Seat Functions: Electronic

Parking Sensors: Ok

Rear View / Side Mirror: Ok

Brake System

Brake Pads Front: 60%

Brake Pads Rear: 50%

Brake Disc Frt And Rear: Need to skimming

ABS Sensor: Ok

Hand Brake: Manual

Suspension & Tyres

Front Suspension: Ok

Rear Suspension: Ok

Rims Brand /Size: FORD. size- 20

Tyre Size: 225/50 (2019)

Tyre Condtions: All is 2019. Rear Tyre is not good condition

Fault Photos





INTERIOR

Interior

Roof Lining: Ok

Arm Rest: Ok

Side Pockets: Ok

Steering Wheel Upholstery: Ok

Seat Upholstery: Ok

Gear Lever: Ok

Floot Mat: Ok

Trunk lining: Ok

Dashboard: Good

Front Windscreen: Ok

Rear Windscreen: Ok

Doors: Ok (have small small scratches)

:

Engine Bay and Undercarriage Photos



Interior Photos



Vehicle Diagnostic Report

 USAFORD_1FM5K8GT8GGC7....pdf